

Main Shaft Not at the Fixed Position, Menu Search Screen at start up

VT-ASP-645-1 model does not have Main shaft Wheel, so in situations where the machine gives Error **SP-Unit Fix Error o6**, And Machine will not color change correctly, it may be due to the machine main shaft is not at the fixed position.

To set the machine to the fixed position:

- 1) Power the machine Off and then On again to get to the screen shown below:

```
-- ASP Main Menu --  
Menu Search  
Press Check Next END  
Press UP/DOWN or SET
```

- 2) Press the **END** button. The error beeping will end and the screen will show the following screen: Press the **SET button**. (The Main Shaft will rotate to the “o” Degree Mark or the Fixed Position automatically.

```
-- ASP Main Menu --  
Menu Search:  
Set to Exit Error  
Press UP/DOWN or SET
```